

Ref: LBC/19/00686 – TSD06  
Date: 20/08/2025



## **MATERIAL SAMPLES CONDITION: CONDITION 2 APPLICATION – SHIREHALL REF: LBC/2019/00686**

Please find below photographs taken of the samples of materials proposed for the REPLACEMENT of cleaved / cracked STONES of the grins hill / witton fell (buff sandstone colour) on selected areas to South (front) facade at the above applicant site:



Plate 1: Existing stone face delaminations  
Marked with chalk and templated for replacement



Plate 2: Witton Fell quarry, Buff sandstone  
matched to pieces of existing fallen stone at Shirehall.



Plate 3: Cutting out defective stones



Plate 4: New stone arrived ready for carving

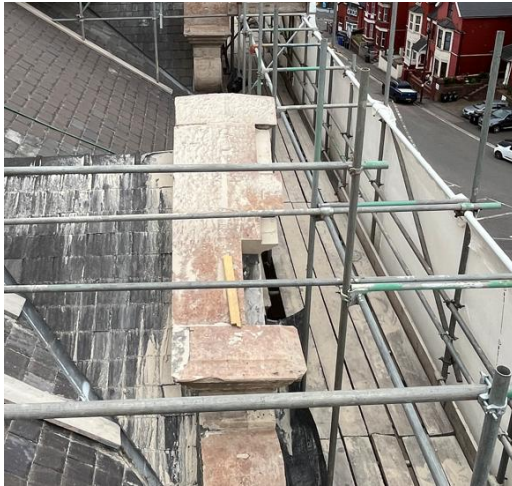


Plate 5: Cutting out defective stone (pediment 3)  
Templating completed for new stone order.

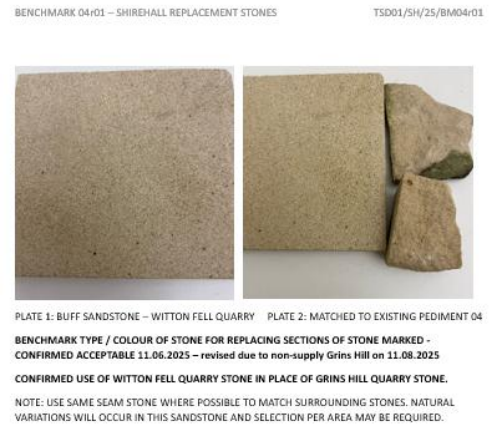


Plate 6: Benchmarking document for  
replacement stone approval.

Cleaved, split and delaminated Buff sandstones faces (South elevation) of Shirehall replaced using new Witton Fell Quarry Buff sandstone slips (min 50mm thick), pinned with stainless steel rods to existing good stone, bedded on lime mortar with buff lime pointing over to exactly match existing stones in type, colour, dimensions and fit.

A total of 66 stones identified to pediments, chimneys and hood / window surround to first floor - require slip stone replacements.

